

PETROLEUM CONTAINMENT, INC. COLLAR BASE INSTALLATION

- 1.) Prep surface of collar on UST tank and inside surface of the collar base with 80 grit or coarser sandpaper
Clean sanded surfaces with acetone or a good grade of paint thinner.
- 2.) Place sump base on collar, making sure outside surfaces are dry, wrap outside seam on collar base with duct tape to prevent epoxy from leaking during cure cycle
- 3.) Mix one epoxy kit per sump (E142CM for 42" collar, E148CM for 48" collar) following instructions on label pour complete mixed kit into inside groove of collar base. Let stand for 45 minutes to an hour for epoxy to cure at 70 degrees. Colder climates may need to warm epoxy prior to use and allow for longer cure times.
- 4.) Once epoxy has cured complete piping and electrical before installing canopy and riser.
- 5.) Proceed to installation of fixed riser or ART riser following instructions for these installations.



**FOR TECHNICAL ASSISTANCE CONTACT
PETROLEUM CONTAINMENT, INC.
(904) 358-1700**